
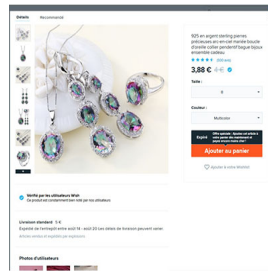


Alert number **[A12/00668/21](#)**

Product **Jewellery set**

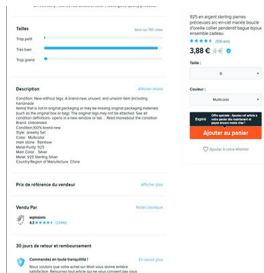

Risk type **Chemical**

**The product contains an excessive amount of cadmium (measured values: up to 93% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Silver-coloured metal set comprising a ring with a greenish and pink stone, a pair of hoop earrings with three drop stones (different-sized greenish and pink stones), and a necklace with a pendant (greenish and pink stone). The product was sold online, in particular via Wish.**

Packaging description **Packaged in a transparent plastic bag**

Brand **Unknown**

Name **925 en argent sterling pierres précieuses arc-en-ciel mariée boucle d'oreille collier pendentif bagu**

Weekly report number **Report-2021-20**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Removal of this product listing by the online marketplace  
Other**

Alert number **[A12/00689/21](#)**

Product **Children's sleep bag**



Risk type **Injuries**

**The slide fasteners do not have a top stop. A child may pull down the zipper and climb from the cot suffering injuries.**

**The product does not comply with the relevant European Standard EN 16781.**

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Children's sleep bag in pink and white; 100% cotton.**

Brand **Вис Виталис**

Type / number of model **model Maksi, арт. №212247, №212248, №21249, №212250, №212251, №212252/, depending of the size**

Weekly report number **Report-2021-20**

Alert submitted by **Bulgaria**

Is the product counterfeit? **No**


Country of origin **Bulgaria**

Measures ordered by public authorities **Withdrawal of the product from the market  
Manufacturer**

Date of entry into force **12/03/2021**

Alert number **[A12/00666/21](#)**

Product **Welding machine**

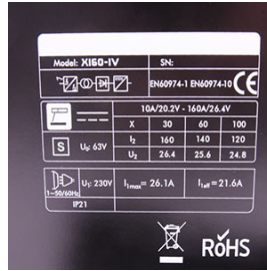

Risk type **Electric shock**

**The electrical insulation is inadequate and the creepage distances between the primary and accessible secondary circuits are not sufficient. Accessible parts can become live and the user could receive an electric shock from them.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60974-1.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Welding machine Electrical specifications: 230V AC; 50/60Hz ; IP21; 4.9kVa. The product was also sold online.**

Brand **Pitstone**

Type / number of model **160A**

Barcode **6438284134380**

Weekly report number **Report-2021-20**

Alert submitted by **Finland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public  
authorities

**Recall of the product from end users  
Importer**

Date of entry into force

**21/01/2021**

Alert number

**[INFO/00112/21](#)**

Product

**Foam Facial Interface for a VR Headset**



Corrigendum

**This notification INFO/00112/21 is updated according to information submitted by the competent Authority on 20/05/2021.**

Risk type

**Chemical**

**The foam of the product contains substances which are skin and eye irritants. Consequently the user could suffer from irritation.**

**The product does not comply with the requirements of the General Product Safety Directive.**

Category

**Other**

Type

**Consumer**

Description

**Removable foam facial interfaces of the Oculus Quest 2 Virtual Reality Headsets. The product was sold online by a number of online retailers including Amazon.**

Packaging description

**The Facial Interface is provided: (i) in-box with the Oculus Quest 2 Virtual Reality headset; and (ii) sold separately as part of the Quest 2 Fit Pack. Packed in a white cardboard box with Oculus branding and an image of the product.**

Brand

**Oculus Quest 2**

Name

**Foam Facial Interface for Oculus Quest 2 Virtual Reality Headset.**



Weekly report number	<b>Report-2021-20</b>
Alert submitted by	<b>Ireland</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Other : Replacement of Interface for Affected Consumers Manufacturer</b>
Date of entry into force	<b>22/12/2020</b>
Company recall code	- <a href="https://support.oculus.com/1504463656600795">https://support.oculus.com/1504463656600795</a> - <a href="https://www.oculus.com/blog/customer-support-update-forquest-2-foam-interface/">https://www.oculus.com/blog/customer-support-update-forquest- 2-foam-interface/</a> - <a href="https://support.oculus.com/">https://support.oculus.com/</a>
Products were found and measures were taken also in	<b>Malta</b>

Alert number

**[A12/00667/21](#)**

Product

**Teeth Whitening Kit**

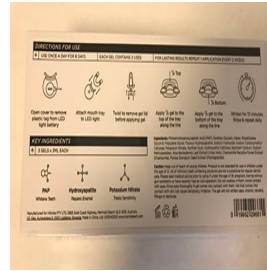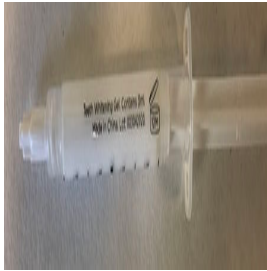

Risk type **Chemical**

**The product contains hypochlorous acid (measured value: 250 mg/kg), which, in contact with water, generates sodium hypochlorite. Exposure to sodium hypochlorite causes irritation of the mouth.**

**The product does not comply with the Cosmetic Products Regulation.**

Category **Cosmetics**

Type **Consumer**

Description **Kit containing 3 syringes with whitening substance. The product was also sold online.**

Packaging description **White box with "HiSMILE Teeth Whitening Kit" written on it.**

Brand **HiSMILE**

Name **Teeth Whitening Kit from HiSMILE Teeth Whitening K**

Type / number of model **Lot nr.: 003042020**

Barcode **019962296611**

Weekly report number **Report-2021-20**

Alert submitted by **Denmark**



Is the product counterfeit? **No**

Country of origin **Australia**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **03/05/2021**

Measures taken by economic operators **Other : Have not answered  
Manufacturer**


Date of entry into force **03/05/2021**

Alert number

**[A12/00683/21](#)**

Product

**Bamboo placemats**

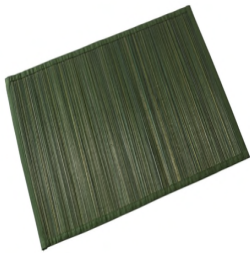

Risk type

**Chemical**

**The green variant of the product contains azo dyes releasing 3,3'-dimethoxybenzidine (measured value: 360 mg/kg). Furthermore, the brown variant of the product contains azo dyes releasing benzidine (measured value: 150 mg/kg). In the event of longer-term direct skin contact, aromatic amines can be absorbed through the skin. Aromatic amines can cause cancer and cell mutations and affect reproduction.**

**The product does not comply with the REACH Regulation.**

Category

**Other**

Type

**Consumer**

Description

**Dark-green or brown place settings made of bamboo and cotton with piping around the edges and a fabric label with the Villeroy & Boch logo. The size is 33 cm x 48 cm. The product was also sold online.**

Brand

**Villeroy & Boch**

Name

**Essentials Bamboo Platzset**

Type / number of model

**35-9040-0005  
35-9040-0009**

Barcode

**4003683460846  
4003683460884**

Weekly report number

**Report-2021-20**

Alert submitted by	<b>Germany</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>India</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>30/04/2021</b>
Measures taken by economic operators	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>30/04/2021</b>
Measures taken by economic operators	<b>Removal of this product listing by the online marketplace Distributor</b>
Date of entry into force	<b>30/04/2021</b>
Measures taken by economic operators	<b>Warning consumers of the risks Distributor</b>
Date of entry into force	<b>30/04/2021</b>
Company recall code	- <a href="https://www.villeroy-boch.de/dining-lifestyle/unsere-services/kontakt/bamboo.html?utm_source=tk_b2b&amp;utm_medium=print&amp;utm_campaign=tk_bamboo">https://www.villeroy-boch.de/dining-lifestyle/unsere-services/kontakt/bamboo.html?utm_source=tk_b2b&amp;utm_medium=print&amp;utm_campaign=tk_bamboo</a>

Alert number **[A12/00671/21](#)**

Product **Four-wheeled all terrain vehicle**



Risk type **Injuries**

**The steering knuckle may detach from the lower suspension arm. This could result in a loss of control over the vehicle, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Four-wheeled all terrain vehicle**

Brand **Can-Am**

Name **Outlander, Renegade**

EC-type approval/model **e13\*167/2013\*00124\*04, e13\*167/2013\*00123\*04**

Production dates **2021**

Company recall code **2021-7**

Weekly report number **Report-2021-20**

Alert submitted by **Belgium**

Is the product counterfeit? **No**

Country of origin **Mexico**

Measures taken by economic operators **Recall of the product from end users  
Importer**

Date of entry into force **10/05/2021**

Products were found and measures were taken also in **France  
Slovenia**

Alert number **[A12/00688/21](#)**

Product **Earrings**



Risk type **Chemical**

**The earrings' pendants contain excessive amounts of cadmium and lead (measured values: up to 57% and 0,14% by weight, respectively). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer. Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **A pair of earrings attached to cardboard with the text "Fashion Jewellery". The product was also sold online, in particular via Amazon.**

Brand **Fashion Jewellery**

Name **XHNNI Bohemian Alloy Earrings Girls Womens Earring**

Weekly report number **Report-2021-20**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators

**Withdrawal of the product from the market  
Distributor**

Date of entry into force

**27/01/2021**

Alert number

**[A12/00690/21](#)**

Product

**Particle filter mask**



Risk type

**Health risk / other**

**The product bears a CE marking but its filtering capacity has not been tested by a relevant competent European conformity assessment body. Additionally, the particle/filter retention of the material is insufficient (measured values: as low as 39%), the total filtration capacity of the mask is insufficient (measured mean values: as low as 75%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.**

Category

**Protective equipment**

Type

**Consumer**

Description

**Face masks packed in individual labelled transparent plastic, in boxes of 50 Face masks with ear lugs marked (PM2.5 95 FFP2 Panodyne CE)**

Packaging description

**Face masks packed in individual labelled transparent plastic, in boxes of 50 with dimensions of 200x100x100mm/box**

Brand

**Panodyne**

Name

**Personal Face Mask N95**

**FBN95M-U**



Type / number of model

Batch number **V001 19.03.2020**

Barcode **5060710519051**

Weekly report number **Report-2021-20**

Alert submitted by **Malta**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **04/05/2021**

Alert number

**[A12/00685/21](#)**

Product

**Particle filter mask**



Risk type

**Health risk / other**

**The mask does not properly adapt to the face. Consequently, an excessive amount of particles or microorganisms might pass; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment (PPE) Regulation and the relevant European standard EN 149.**

Category

**Protective equipment**

Type

**Consumer**

Description

**The face mask is of uniform light blue material, with white edges and without valve. The mask has white straps to be attached around the ears.**

Packaging description

**The product is sold in a white with blue highlights cardboard box containing 50 pieces.**

Brand

**Unknown**

Name

**Disposable Mask (Non-medical)**

Weekly report number

**Report-2021-20**

Alert submitted by

**Romania**

Is the product counterfeit?

**Unknown**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Withdrawal of the product from the market  
Distributor**

Date of entry into force

**11/05/2021**

Alert number

**[A12/00687/21](#)**

Product

**Hand disinfectant**

Risk type

**Fire  
Health risk / other**

**The product contains an insufficient amount of ethanol and propan-2-ol (measured values: 53.1% and 6.6% by weight, respectively). Consequently, it does not kill bacteria or viruses, which could then reach the user, increasing the risk of infection. Furthermore, the packaging is not accompanied by the appropriate hazard pictograms and warnings. Users have therefore no information on the toxicity and flammability of the product, which in the presence of an ignition source, could lead to a fire.**

**The product does not comply with the Biocidal Products and the Classification, Labelling and Packaging (CLP) Regulations.**

Category

**Chemical products**

Type

**Consumer**

Description

**500 ml of transparent hydro-alcoholic hand disinfectant, with gel consistency. The product was also sold online, in particular via eMAG.**

Packaging description

**The product is sold in a transparent plastic bottle.**

Brand

**Mr. Oxi**

Name

**Antibacterial Hand Gel**

Batch number

**L 8****5943091006023**

Barcode

Weekly report number **Report-2021-20**

Alert submitted by **Romania**

Is the product counterfeit? **No**

Country of origin **Romania**

Measures taken by economic operators **Withdrawal of the product from the market  
Manufacturer**

Date of entry into force **11/05/2021**

Alert number **[A12/00669/21](#)**

Product **Passenger car**

Risk type **Fire  
Injuries**

**Faulty connection of the inerting system's gas pipes could impair the intended distribution of argon shielding gas to the points where there could be contact between the leaking refrigerant R1234yf and hot engine components in the event of an accident. This would reduce the cooling effect of the inerting gas, leading to increased risk of fire.**

Category **Motor vehicles**

Type **Consumer**

Description **Model series: C-class (BR 205), GLC (BR 253)**

Brand **MERCEDES-BENZ**

Name **C-Class, GLC**

EC-type approval/model **Types: 204, 204 AMG, 204 K, 204 K AMG, 204 X, 204 X AMG e1\*2001/116\*0431\*38 to \*62, e1\*2001/116\*0464\*18 to \*22, e1\*2001/116\*0463\*17 bis \*20, e1\*2001/116\*0457\*37 to \*52, e1\*2001/116\*0480\*18 to \*41, e1\*2007/46\*1884\*00**

Production dates **The affected vehicles were manufactured between 5 February 2016 and 3 November 2020.**

Company recall code **6290101**

Weekly report number **Report-2021-20**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code

- <https://www.Mercedes-Benz.de>

Products were found and  
measures were taken also in

**Greece  
Iceland  
Slovenia**

---

Alert number **[A12/00681/21](#)**

Product **Motorhome**

---

Risk type **Injuries**

**The retractor for the rear safety belts could malfunction. This would reduce the restraining effect of the belts, increasing the risk of injury in the event of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Mobile home/camper van**

Brand **Pössl**

Name **Campster**

EC-type approval/model **Types: EG/DKC 002, EG/DKC 001  
e1\*2007/46\*1781\* 00-01 , e1\*KS07/46\*0061\*00-01**

Production dates **The affected vehicles were manufactured between 1 May 2017 and 31 July 2018.**

Company recall code **54261**

Weekly report number **Report-2021-20**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**



Alert number **[A12/00680/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The screw connections of various chassis components may be faulty. As a result, the driving stability of the vehicle could be impaired, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Porsche**

Name **BOXSTER, CARRERA, CAYMAN, TARGA, TURBO, TAYCAN**

EC-type approval/model **Types: Y1A, 982, 992  
e13\*2007/46\*0919\*02, e13\*2007/46\*1607\*11, \*12,  
e13\*2007/46\*0992\*07, \*08**

Production dates **14 October 2020 to 19 January 2021**

Company recall code **AMA3**

Weekly report number **Report-2021-20**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Poland  
Sweden**

---

Alert number **[A11/00036/21](#)**

Product **Set of soft toys**

---



Risk type **Choking**

**The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. A small child may put the stuffing material in the mouth and choke.**

**The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Set of soft toys which consists of a ball and a cube. Toys are filled with stuffing materials and coated with textile material.**

Packaging description **Foil bag.**

Brand **Unknown**

Name **Zestaw dla malucha**

Type / number of model **TG379438-5012-BH208-1342**

Barcode **5902553814835**

Weekly report number **Report-2021-20**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market  
Importer**

Date of entry into force **26/03/2021**

Company recall code - <https://toysgroup.pl/komunikaty/>

---

Alert number **[A12/00679/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The safety belt restraint system might only work to a limited extent in the event of sharp braking or lateral tilting of the vehicle. This will lead to an increased risk of injury.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Audi**

Name **Q3, Q3 RS**

EC-type approval/model **e1\*2007/46\*1900\*, e1\*2007/46\*2038\*, Type: F3**

Production dates **The affected vehicles were manufactured between 1 February and 31 March 2021**

Company recall code **69CA**

Weekly report number **Report-2021-20**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Greece  
Sweden  
Slovenia**

Alert number **[A12/00686/21](#)**

Product **Hand disinfectant**



Risk type	<p><b>Fire</b> <b>Health risk / other</b></p> <p><b>The product contains an insufficient amount of ethanol and propan-2-ol (measured values: 44.3% and 7.1% by weight, respectively). Consequently, it does not kill bacteria or viruses, which could then reach the user, increasing the risk of infection. Furthermore, the packaging is not accompanied by the appropriate hazard pictograms and warnings. Users have therefore no information on the toxicity and flammability of the product, which in the presence of an ignition source, could lead to a fire.</b></p> <p><b>The product does not comply with the Biocidal Products and the Classification, Labelling and Packaging (CLP) Regulations.</b></p>
Category	<b>Chemical products</b>
Type	<b>Consumer</b>
Description	<b>100 ml of transparent hydro-alcoholic antibacterial sanitizing hand gel.</b>
Packaging description	<b>The product is sold in a transparent plastic bottle. The product was also sold online, in particular via eMAG.</b>
Brand	<b>Smart</b>
Name	<b>Antibacterial Sanitizing Gel</b>
Type / number of model	<b>SEJ100</b>

**2020/G73; production date 14.05.2020**

Batch number	
Barcode	<b>8697422828798</b>
Weekly report number	<b>Report-2021-20</b>
Alert submitted by	<b>Romania</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Turkey</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>11/05/2021</b>

Alert number **[A12/00676/21](#)**

Product **Musical toy**



Risk type **Choking**

**Small parts (plastic leaves) may easily detach from the toy. A child may put them in the mouth and choke on them.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Plastic musical toy resembling a slice of kiwi. Battery powered.**

Packaging description **No packaging.**

Brand **Unknown**

Name **Organki na baterie**

Type / number of model **G137387-J85-02-7096**

Barcode **5900949420264**

Weekly report number **Report-2021-20**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Withdrawal of the product from the market  
Importer**

Date of entry into force

**12/03/2021**



Alert number **[A12/00675/21](#)**

Product **Plastic doll**



Risk type **Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP), (measured value up to 19,8% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Plastic doll with plastic accessories.**

Packaging description **Plastic packaging.**

Brand **Unknown**

Name **Beautiful Ana**

Type / number of model **YT08779**

Barcode **6933893328460**

Weekly report number **Report-2021-20**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures taken by economic operators **Destruction of the product  
Distributor**

Date of entry into force **21/04/2021**

Measures taken by economic operators **Withdrawal of the product from the market  
Distributor**

Date of entry into force **21/04/2021**

Alert number **[A12/00670/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The retaining force of the power liftgate drive motor may be insufficient and the support may be reduced especially at high ambient temperatures. As a result, the power liftgate could unexpectedly lower while a person is accessing the rear storage area of the vehicle, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Mazda CX-30 (DM); Countries of production: Japan and Mexico. VIN's: JMZDM\*\*\*\* 00 100068 - 159370 and 3MVDM\*\*\*\* 0E 100020 - 114559.**

Brand **Mazda**

Name **CX-30**

EC-type approval/model **e13\*2007/46\*2041\*00, e13\*2007/46\*2041\*01, e13\*2007/46\*2041\*04, e13\*2007/46\*2041\*06**

Production dates **The affected vehicles were manufactured between 25 April 2019 and 15 October 2020.**

Company recall code **AM006A**

Weekly report number **Report-2021-20**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users  
Distributor**

Products were found and  
measures were taken also in

**Poland**  
**Sweden**



---

Alert number **[A12/00678/21](#)**

Product **Passenger car**

---

Risk type **Fire**

**Cracks may form in the EGR cooler. This could increase the risk of the vehicle catching fire.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Jeep**

Name **Grand Cherokee**

EC-type approval/model **Individual approval**

Production dates **The affected vehicles were manufactured between 19 December 2012 and 17 January 2019.**

Company recall code **W79**

Weekly report number **Report-2021-20**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number **[A12/00684/21](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

**The particle/filter retention of the material is insufficient (measured values as low as 44%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment (PPE) Regulation.**

Category **Protective equipment**

Type **Consumer**

Description **White half-face masks**

Packaging description **Cardboard box with 50 masks, each individually packed in transparent plastic packaging with labelling.**

Brand **GAOZHEN**

Name **KN95 Protective Mask FOR ADULT**

Type / number of model **GZ-KN95**

Batch number **20200501**

Barcode **6935624000188**

Weekly report number **Report-2021-20**

Alert submitted by	<b>Germany</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Recall of the product from end users Retailer</b>
Date of entry into force	<b>20/04/2021</b>

---

Alert number **[A12/00677/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The threads of the wheel bolts may be defective. This could lead to the detachment of a wheel, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Car**

Brand **Citroen**

Name **C4**

EC-type approval/model **Type: B  
e9\*2007/46\*6816\*02, e9\*2007/46\*6816\*04**

Production dates **The affected vehicles were manufactured on 10 and 11 February 2021.**

Company recall code **HQM**

Weekly report number **Report-2021-20**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Unknown**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **France  
Poland**



Alert number **[A12/00674/21](#)**

Product **Plastic toy**



Risk type **Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP), (measured value up to 11,3% by weight) and diisobutyl phthalate (DIBP) (measured value up to 12,8% by weight). These phthalates may harm the health of children, causing possible damage to their reproductive system and/or liver.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Set of three squeezable toys with squeaking elements. Toys are made of soft plastic material.**

Packaging description **Net bag with label attached.**

Brand **Unknown**

Name **Zabawka**

Type / number of model **03341**

Barcode **8008280033413**

Weekly report number **Report-2021-20**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Destruction of the product  
Distributor**


Date of entry into force **19/04/2021**

Measures ordered by public authorities **Withdrawal of the product from the market  
Distributor**

Date of entry into force **19/04/2021**

Alert number **[A12/00682/21](#)**

Product **Warning triangle**

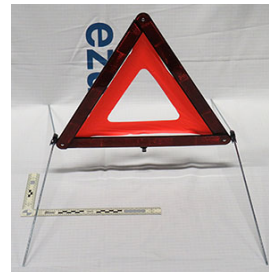

Risk type **Injuries**

**The stability of the warning triangle is inadequate. If the warning triangle is overturned or turned, it will not be visible and it could become an obstacle to the traffic, be struck by other vehicles and cause an accident.**

**The product does not comply with the requirements of the Economic Commission for Europe (ECE) Regulation No. 27.**

Category **Other**

Type **Consumer**

Description **Warning triangle - consisting of four metal legs and a triangle of equilateral sides, on the front side of which there is a reflecting surface made of fluorescent material.**

Packaging description **Red plastic package with the approval mark E11 in a circle with the number 27R 043555. On the warning triangle is the trade mark with the manufacturer's designation HAO XING HXJ-2.**

Brand **Unknown**

Type / number of model **Homologation number: E11 27R 043555n Art. Nr.: HXJ -2**

Barcode **EAN: 8591686015232**

Weekly report number **Report-2021-20**

Alert submitted by **Slovakia**

Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>27/01/2021</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>27/01/2021</b>
Measures ordered by public authorities	<b>Warning consumers of the risks Distributor</b>
Date of entry into force	<b>27/01/2021</b>

Alert number **[A12/00673/21](#)**

Product **Expandable toy**



Risk type **Choking  
Injuries**

**The expanding material increases in size when placed in water by more than 50%. The toy can be put into the mouth and swallowed by children. As the toy expands, it can cause fatal occlusion of the respiratory track or intestinal blockage of small children. Small part (dinosaur's head) may easily detach form the toy. A child may put it in the mouth and choke on it.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **An egg (size 60 mm) made of easily breaking plastic, containing a dinosaur figurine made of expandable material.**

Packaging description **No packaging.**

Brand **Unknown**

Name **Growing Pet / Jajo**

Type / number of model **#9001B**

Barcode **5902734390899**

Weekly report number	<b>Report-2021-20</b>
Alert submitted by	<b>Poland</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>13/04/2021</b>

Alert number **[A12/00672/21](#)**

Product **Plastic doll**



Risk type **Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP), (measured value up to 28,95% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Plastic doll.**

Packaging description **Cardboard box.**

Brand **Unknown**

Name **Beautiful Princess**

Type / number of model **DOLL 0523 (ZR 595)**

Weekly report number **Report-2021-20**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities

**Import rejected at border  
Importer**

Date of entry into force

**30/03/2021**

